

Work Order ID 122227

122227

Page 1

July-14-14 9:52:39 AM

Item ID: D412-664-403

Accept

N900040100

Setup Start *NS1*

Revision ID:

Stop *NS2*

Item Name: 412 Stainless Steel Aft Crosstubes - High

Start Date: 7/14/14 Start Qty: 1.00 *1*

Cust Item ID:

Required Date: 7/14/14 Req'd Qty: 1.00 *1*

Customer:

Reference:

Approvals: Process Plan: MJS Date: 14-07-14

Tooling:

Date:

Run Start *NR1*

QC: _____ Date: _____ SPC (Y/N): _____

Date:

Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr	Revision Nbr
----------	--------------

D412-664-443

A

DAS
6
9-89

100

Document Control

0.00

DOCUMENT CONTROL

100

DC

Memo

0.00

Doc.Control - USB or Paperwork

Photocopy bluefile & type labels per PPPD412-664-403 CHG001

Mh

DAS
46
9-89

APR 14 2015

110

BENDING MACHINE - CROSSTUBES

0.00

110

CNC Bend 2

Memo

0.00

CNC Alpha 160 Bender

Bend tube as per Dwg D412-664-443 using CNC bender program _____ and Folio FT _____

TW 15-04-09
BL

****USE (4) DT9824 SHIM BLOC TO CHECK STRAIGHTNESS****

127

QC15- Crosstube Dimensional Check

0.00

127

QC

Memo

0.00

Quality Control

MARK CUT LINES

DAS
03
9-89

D 15-4-9

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Crosstube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐
--	--	---

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

Work Order ID 122227

122227

Page 2

July-14-14 9:52:39 AM

Item ID: D412-664-403 Accept *N900040100* Setup Start *NS1*
 Revision ID: Stop *NS2*
 Item Name: 412 Stainless Steel Aft Crosstubes - High
 Start Date: 7/14/14 Start Qty: 1.00 *1* Cust Item ID:
 Required Date: 7/14/14 Req'd Qty: 1.00 *1* Customer:
 Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start *NR1*
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

128

0.00

128

Crosstubes

Crosstubes

Memo

CUT TUBE AT HEIGHT ON FAI SHEET

VERF HEIGHT 24.37 BY QC 15 LEVEL INSPECTOR

VERF TWIST 0.208 BY QC15 LEVEL INSPECTOR

0.00

0.00

130

130

Crosstubes

Crosstubes

Crosstubes

Memo

1- Drill Tube as per Dwg D412-664-443 Using DT _____ Drill Jigs,
 Set-up drill table as per QSI 010

2-Deburr

3- Engrave Part # and Batch # as per Dwg D412-664-443

4-Remove all marks from tube within limits of D412-664-43 DWG.

3.03
DAS

15-4-9

JW 15-04-09

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Crosstube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐
--	--	---

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Crosstube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐
--	--	---

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

Work Order ID 122227

122227

Page 4

July-14-14 9:52:39 AM

Item ID: D412-664-403

Accept

N900040100

Setup Start *NS1*

Revision ID:

Stop *NS2*

Item Name: 412 Stainless Steel Aft Crosstubes - High

Start Date: 7/14/14 Start Qty: 1.00 *1*

Cust Item ID:

Required Date: 7/14/14 Req'd Qty: 1.00 *1*

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start *NR1*

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

178

QC5- Inspect part completeness to step on W/O

0.00

178

QC

Memo

0.00

Quality Control

DAS

9

9-89

APR 10 2015

180

SprayPaint

0.00

180

SprayPaint

Memo

0.00

Spray Painting

1-Prime inside & outside crosstube as per QSI 005 4.2

BATCH: 130849

2- MASK UNDERSIDE OF CROSSTUBE AS SHOWN ON DWG BEFORE PAINTING

3 -Paint Outside of Tube as per.Dart QSI 005 4.2

BATCH: 131841

4- After painting remove masking and apply matte clear coat per QSI005 4.2

CLEAR BATCH: 131983

1

CH 15 09 11

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Crosstube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐
--	--	---

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

Work Order ID 122227

122227

Page 5

July-14-14 9:52:39 AM

Item ID: D412-664-403

Accept

N900040100

Setup Start

NS1

Revision ID:

Stop

NS2

Item Name: 412 Stainless Steel Aft Crosstubes - High

Start Date: 7/14/14

Start Qty: 1.00

1

Cust Item ID:

Required Date: 7/14/14

Req'd Qty: 1.00

1

Customer:

Reference:

Run Start

NR1

Stop

NR2

Approvals:

Process Plan:

Date:

Tooling:

Date:

QC:

Date:

SPC (Y/N):

Date:

Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID

Tool #

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

190

QC14- Inspect Spray Paint

0.00

190

QC

Memo

0.00

Quality Control

DAS

9

9-89

PTO →

15-01-16

DQA:

Date:

15/05/15

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed:

Date:

15/05/11

Work Order update only ☐

Work Order: <u>122227</u> Part No: <u>12412-664-403</u> NCR No. <u>15-4926</u>	DISPOSITION Rework ☒ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☒ Machining ☐ Thermoforming ☐ Large Fab ☐ Crosstube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐
--	---	---

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design						strip tube	EN 1504/14		
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									
	150413	180	3	tube as lots of imperfection in paint - runs in paint, dust in paint, primer strip not done as per drawing. P.C. operator not following instruction	S Q22004 15/04/13	spray paint as per drawing. repeat sequence 180 A → PORN Q22005 Topcoat B#131841 Per Q51005	EN 1504/14 EN 1504/14 DAS 41 9-89 15-4-14	DAS 9 9-89 150416	DAS 9 9-89 150416

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☒ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge	☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	---	---	--	--

Work Order ID 122227

July-14-14 9:52:39 AM

122227

Page 6

Item ID:	D412-664-403	Accept	*N900040100*	Setup	Start	*NS1*
Revision ID:					Stop	*NS2*
Item Name:	412 Stainless Steel Aft Crosstubes - High					
Start Date:	7/14/14	Start Qty:	1.00	Cust Item ID:		
Required Date:	7/14/14	Req'd Qty:	1.00	Customer:		
Reference:						

Approvals:	Process Plan:	Date:	Tooling:	Date:	Run	Start	*NR1*
	QC:	Date:	SPC (Y/N):	Date:		Stop	*NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
200		0.00							DAS
2000	Crosstubes					1			41
Crosstubes									9-80
Crosstubes									15-4-15

Memo

1- Install center support using scoth-weld DP460 per QSI 015, as per DWG. note 12. Install supports clamps using as per Dwg D412-644-443. Install clamp with rubber cushion as per DWG. note 13. ***ENSURE CLAMPS ARE ON TOP OF CROSTUBE SUPPORT*** Torque clamps on support to 80-100 IN-LBS AS PER DWG.

A/R scoth-weld DP460 BATCH #: 131539
EXP DATE: 2/16

2- **IF NOT ALREADY PRESENT ON CHAFFING SHEILD.** Apply a thin coat of proseal 890 per QSI 015 on inside concave surface of chafing shield and let cure per manufacturer's instructions. Install prosealed chafing shield onto crosstube by applying a thin coat of proseal 890 onto crosstube. Be sure to eliminate any air gaps. Install and torque clamps on chafing shield to 40-50 IN-LBS AS PER DWG.

A/R Proseal 890 Batch: 131670
EXP DATE: 10/15

AFTER FINISH CURE TIME 24H
START CURE TIME: 15-4-15
FINISH CURE TIME: 15-4-16

PRIOR TO PACKAGING RE-CHECK TORQUE ON CLAMPS AFTER CURED FOR 24H.

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td style="width: 33%;"> Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ </td> <td style="width: 33%;"> Crosstube ☐ Small Fab ☐ Finishing ☐ Composite ☐ </td> <td style="width: 33%;"> Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ </td> <td style="width: 33%;"> Engineering ☐ Quality ☐ Other ☐ </td> </tr> </table>	Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐	Crosstube ☐ Small Fab ☐ Finishing ☐ Composite ☐	Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐	Engineering ☐ Quality ☐ Other ☐
Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐	Crosstube ☐ Small Fab ☐ Finishing ☐ Composite ☐	Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐	Engineering ☐ Quality ☐ Other ☐			

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

July-14-14 9:52:39 AM

Page 7

APR 17 2015

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Crosstube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐
--	--	---

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

Work Order ID 122227

July-14-14 9:52:39 AM

122227

Page 8

Item ID: D412-664-403

Accept

N900040100

Setup Start

NS1

Revision ID:

Stop

NS2

Item Name: 412 Stainless Steel Aft Crosstubes - High

Start Date: 7/14/14

Start Qty: 1.00

1

Cust Item ID:

Required Date: 7/14/14

Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start

NR1

QC:

Date:

SPC (Y/N):

Date:

Stop

NR2

Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID

Tool #

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

240

240

Packaging

Packaging

0.00

Memo

0.00

Identify and pack for shipping as per PPPD412-664-443

Location:

PPP Rev:

Ship

DAS
46
APR 17 2015 9-89

DAS
66
9-89

250

250

QC

Quality Control

QC21- Final Inspection - Work Order Release

0.00

Memo

0.00

MCS 15-04-17

*ME
15-4-17*

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Crosstube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐
--	--	---

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

Picklist Print

July-14-14 9:52:42 AM

Page 1

Work Order ID: 122227

122227

Parent Item: D412-664-403

D412-664-403

Parent Item Name: 412 Stainless Steel Aft Crosstubes - High

Start Date: 7/14/14

Required Date: 7/14/14

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP REV:A 13.10.25 NEW ISSUE DD VERF:JLM

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
AN6-40A		Purchased	No				Each	81.0000		4			
AN6-40A	DAS 46								**			DAS 27 6 9-89	
Bolt	9-89											9-89	
Location Loc Qty Loc Code													
ST333 81													
M128634 31													
M129521 50													
AN6-41A		Purchased	No				Each	40.0000		2			
AN6-41A	DAS 46								**			DAS	
Bolt	9-89											6 9-89	DAS 27 9-89
Location Loc Qty Loc Code													
ST333 40													
M126180 4													
M128849 36													
AN960JD616	NAS1149D0663J	Purchased	No				Each	0.0000					
AN960JD616	DAS 46								**			DAS	
Washer	9-89											6 9-89	DAS 27 9-89

APR 17 2015

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Crosstube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐
--	--	---

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

Picklist Print

July-14-14 9:52:42 AM

Page 2

Work Order ID: 122227

122227

Parent Item: D412-664-403

D412-664-403

Parent Item Name: 412 Stainless Steel Aft Crosstubes - High

Start Date: 7/14/14

Required Date: 7/14/14

Start Qty: 1.00

Required Qty: 1.00

D3595-063-530

Manufactured No

Each

150.0000

2

DAS

41

9-89

15-4-15

D3595-063-530

Rubber Cushion

**

2

Location

Loc Qty

Loc Code

FG

5

82656

5

FP

6

111194

6

LG

2

110937

2

LG051

132

113291

8

117571

124

ST412

5

113930

5

D412-664-443TRN

Manufactured No

Each

3.0000

1

D412-664-443TRN

Crosstube Turning Detail

**

1

15-04-09

Location

Loc Qty

Loc Code

LG

3

119989

1

121263

1

121264

1

D4909-1

Manufactured No

Each

12.0000

1

D4909-1

Support

**

DAS

41

9-89

15-4-15

Location

Loc Qty

Loc Code

LG053

12

109899

1

120359

11

July-14-14 9:52:42 AM

Shop Packet Print

Page 2

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width:100%;"> <tr> <td style="width:33%;"> Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ </td> <td style="width:33%;"> Crosstube ☐ Small Fab ☐ Finishing ☐ Composite ☐ </td> <td style="width:33%;"> Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ </td> <td style="width:33%;"> Engineering ☐ Quality ☐ Other ☐ </td> </tr> </table>	Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐	Crosstube ☐ Small Fab ☐ Finishing ☐ Composite ☐	Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐	Engineering ☐ Quality ☐ Other ☐
Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐	Crosstube ☐ Small Fab ☐ Finishing ☐ Composite ☐	Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐	Engineering ☐ Quality ☐ Other ☐			

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

Picklist Print

July-14-14 9:52:42 AM

Page 3

Work Order ID: 122227

122227

Parent Item: D412-664-403

D412-664-403

Parent Item Name: 412 Stainless Steel Aft Crosstubes - High

Start Date: 7/14/14

Required Date: 7/14/14

Start Qty: 1.00

Required Qty: 1.00

D4910-1

Manufactured No

Each

10.0000

2

DAS

41

9-89

15-4-15

D4910-1

Chaffing Shield

127443

**

2

Location

Loc Qty

Loc Code

LG043

10

121993

10

Each

353.0000

18

CP

**

131317

DAS

DAS27

6 9-89

9-89

APR 17 2015

MS21042L6

Purchased

No

MS21042L6

Nut

DAS
46

9-89

Location

Loc Qty

Loc Code

ST307

353

m127831

23

m128635

30

m129499

300

Each

80.0000

4

**

DAS

41

9-89

15-4-15

MS21920-26

Purchased

No

MS21920-26

Clamp

Location

Loc Qty

Loc Code

LG050

80

107545

11

107974

20

109206

49

4

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width:100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coor. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coor. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coor. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

Picklist Print

July-14-14 9:52:42 AM

Work Order ID: 122227

122227

Parent Item: D412-664-403

D412-664-403

Parent Item Name: 412 Stainless Steel Aft Crosstubes - High

Start Date: 7/14/14

Required Date: 7/14/14

Start Qty: 1.00

Required Qty: 1.00

MS21920-28

Purchased

No

Each

103.0000

2

DAS

MS21920-28

41

Clamp

9-89

15-4-15

2

Location

Loc Qty

Loc Code

FG

1

105884

1

LG050

98

M128363

1

M128771

21

M128772

3

M129279

73

Return2014

4

128717

4

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Crosstube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐
--	--	---


Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

DART AEROSPACE LTD		Work Order:	122227
Description: Crosstube High Aft (412)		Part Number:	D412-664-403
Inspection Dwg: D412-664-443 Rev: A		Page 1 of 1	

Required Dimension	Min	Max
Height	24.12	24.62
1/2 Span	53.56	53.82
Angle	49°	52°
Total Span	107.12	107.64
Bending Passes	8	--
Crushing	--	7%

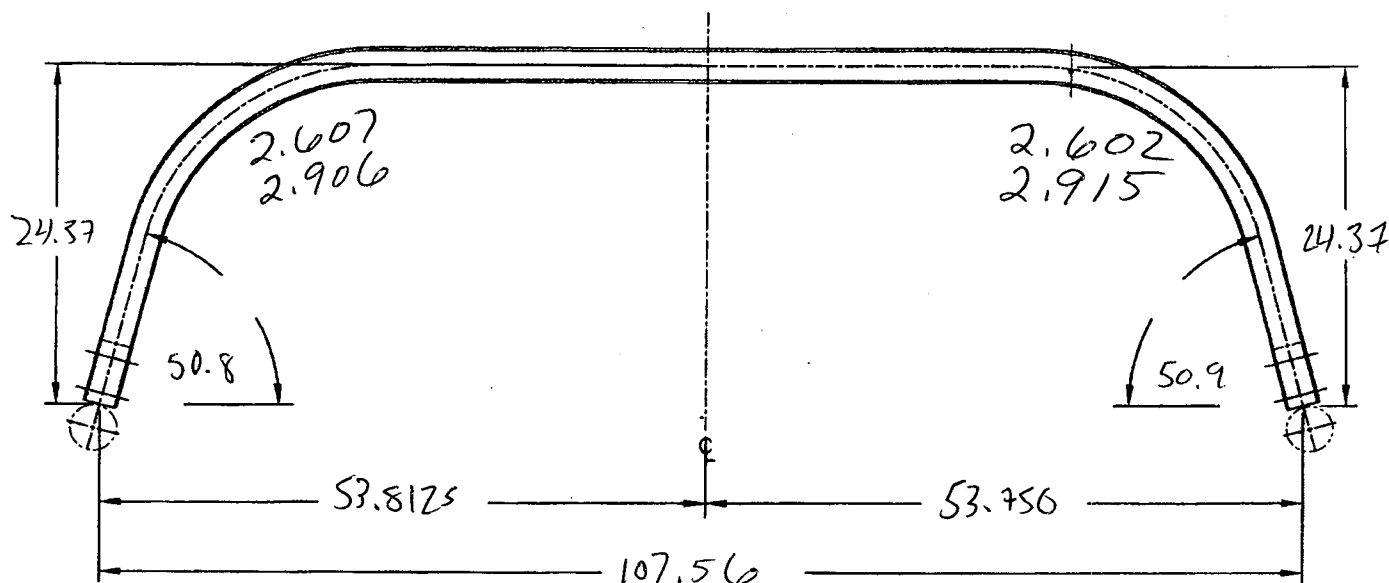

	Side A	Side B
Bending Passes	22	22
Crushing	5.4%	5.7%
Comments		

QC15 Inspection	DD 15-4-9
Date	

Rev	Date	Change	Revised by	Approved
A	14.07.08	New Issue	KJ	UP

Item	Qty -443	Part Number	Description
1	X	D412-664-443	CROSSTUBE ASSEMBLY (412 HI AFT)
2	1	D6020-132	CROSSTUBE MATERIAL (132" MIN. LENGTH)
3	2	D3595-063-530	RUBBER CUSHION
4	1	D4909-1	SUPPORT
5	2	D4910-1	CHAFING SHIELD
7	4	MS21920-26	CLAMP
8	2	MS21920-28	CLAMP
9	A/R	SCOTCH-WELD DP460	EPOXY ADHESIVE, 3M SCOTCH-WELD
10	A/R	PROSEAL 890	SEALANT

GENERAL NOTES:

- 1) MATERIAL: MANUFACTURED FROM D6020-132
FINISHED LENGTH = 130.10±0.060 (BEFORE BENDING/TRIMMING)
- 2) FINISH: PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
MASK UNDERSIDE OF CROSSTUBE AS SHOWN (ZN C6-2, HATCHED AREA)
PAINT OUTSIDE PER DART QSI 005 4.2
AFTER PAINTING, REMOVE MASKING AND APPLY MATTE CLEAR COAT PER DART QSI 005 4.2
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: SCRIBE DART P/N "D412-664-443" AND B/N ON INSIDE OF CUFF PER DART QSI 044 6.4 (VIBRATING STYLUS)
- 7) WEIGHT: 90.2 lb AFTER MACHINING
86.7 lb FINISHED WEIGHT
- 8) PART IS SYMMETRIC ABOUT CENTERLINE.
- 9) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.

BENDING

- 10) BEND PROGRESSIVELY WITH A MINIMUM OF 8 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 7% (BASED ON O.D.) IN LOWER HALF OF R35 BEND AND 8% (BASED ON O.D.) ON REMAINING TUBE.
- 11) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038. TO BE PERFORMED AFTER FINAL POST-BEND GRINDING. ANY ADDITIONAL GRINDING REQUIRES ANOTHER LPI INSPECTION.

ASSEMBLY

- 12) INSTALL D4909-1 CENTER SUPPORT USING A 0.04" TO 0.07" THICK LAYER OF SCOTCH-WELD DP460 PER QSI 015.
- 13) INSTALL MS21920-28 CLAMPS WITH D3595-063-530 RUBBER CUSHIONS TO SECURE THE D4909-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE ON TOP OF CROSSTUBE SUPPORT.
- 14) IF NOT ALREADY PRESENT ON CHAFING SHIELD, APPLY A THIN COAT OF PROSEAL 890 ON INSIDE CONCAVE SURFACE OF D4910-1 CHAFING SHIELD AND LET CURE PER MANUFACTURER'S INSTRUCTIONS. INSTALL PROSEALED D4910-1 CHAFING SHIELD ONTO CROSSTUBE BY APPLYING A THIN COAT OF PROSEAL 890 ONTO CROSSTUBE. BE SURE TO ELIMINATE ANY AIR GAPS.
- 15) TORQUE CLAMPS ON D4909-1 SUPPORT 80 TO 100 IN-LB. TORQUE CLAMPS ON D4910-1 CHAFING SHIELD 40 TO 50 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER ADHESIVES HAVE CURED FOR 24 HOURS.

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 122227 MLC


140714

RELEASED
2014-05-26


A	NEW ISSUE	CP	14.04.01
REV.	DESCRIPTION	BY	DATE
DESIGN			
DRAWN			
CHECKED			
MFG. APPR.			
APPROVED			
DE APPR.			
DATE	14.04.01		

DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWING NO. D412-664-443	REV. A SHEET 1 OF 4
TITLE CROSSTUBE ASSY (412 HI AFT)	SCALE NTS


COPYRIGHT © 2013 BY DART AEROSPACE LTD
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

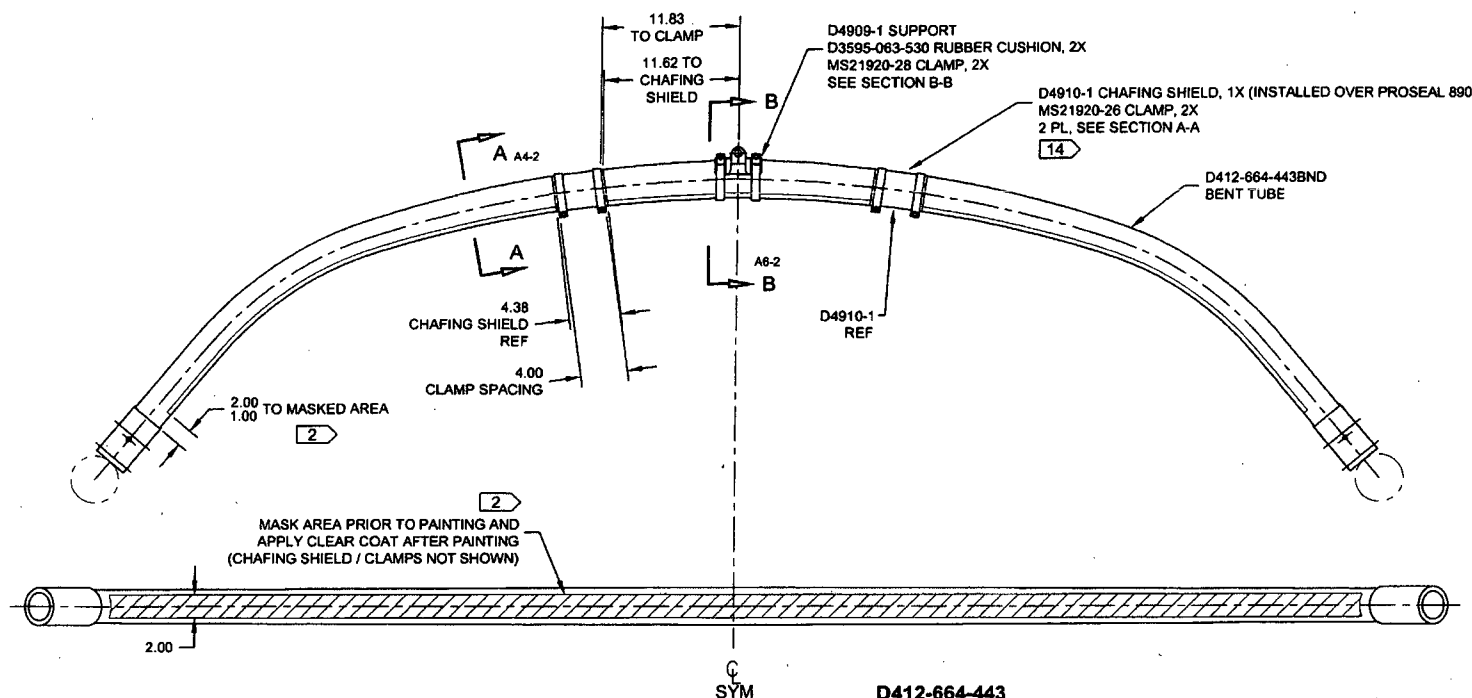

D412-664-443
ASSEMBLY DETAIL

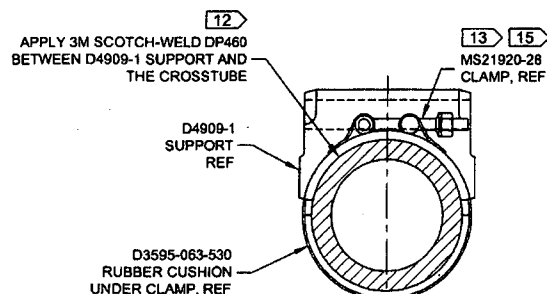


SECTION B-B D4-2
SCALE 4X

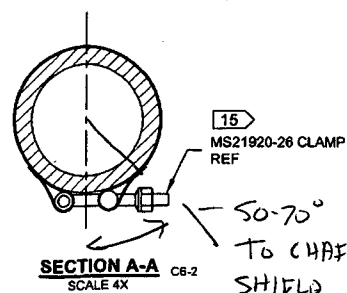


SECTION A-A C8-2
SCALE 4X

RELEASED
2014-05-26
MP

DESIGN	DP	DART AEROSPACE LTD	
DRAWN	DP	HAWKESBURY, ONTARIO, CANADA	
CHECKED	DW	DRAWING NO.	REV. A
MFG. APPR.	DP	D412-664-443	SHEET 2 OF 4
APPROVED	DP	TITLE	SCALE
DE APPR.	DP	CROSSTUBE ASSY (412 HI AFT)	NTS
DATE	14.04.01	COPYRIGHT © 2013 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD			

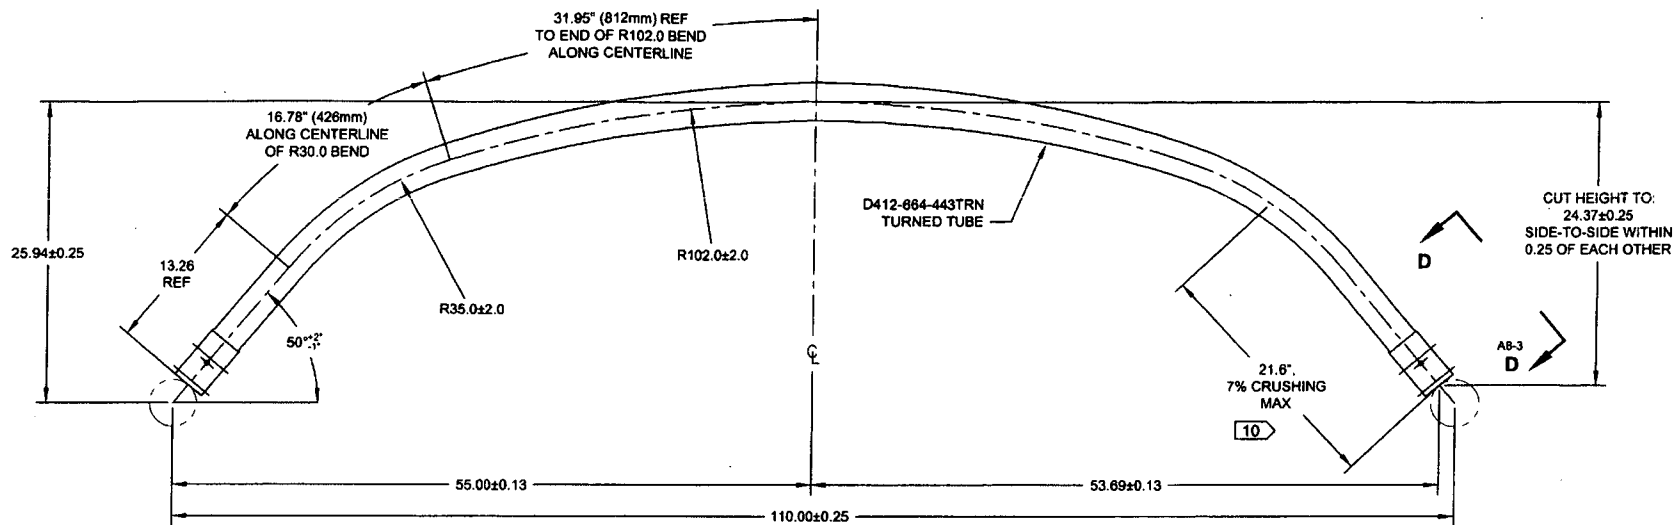


D412-664-443BND
BENDING DETAIL

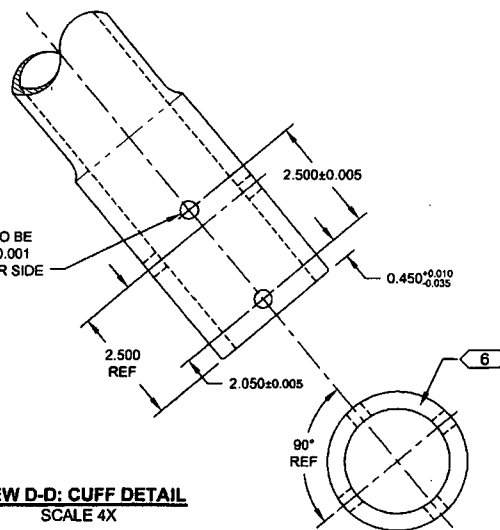


C1-3 **VIEW D-D: CUFF DETAIL**
SCALE 4X

RELEASED
2014-05-26


DESIGN		DART AEROSPACE LTD	
DRAWN		HAWKESBURY, ONTARIO, CANADA	
CHECKED		DRAWING NO.	REV. A
MFG. APPR.		D412-664-443	SHEET 3 OF 4
APPROVED		TITLE	SCALE
DE APPR.		CROSSTUBE ASSY (412 HI AFT)	NTS
DATE	14.04.01	COPYRIGHT © 2013 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

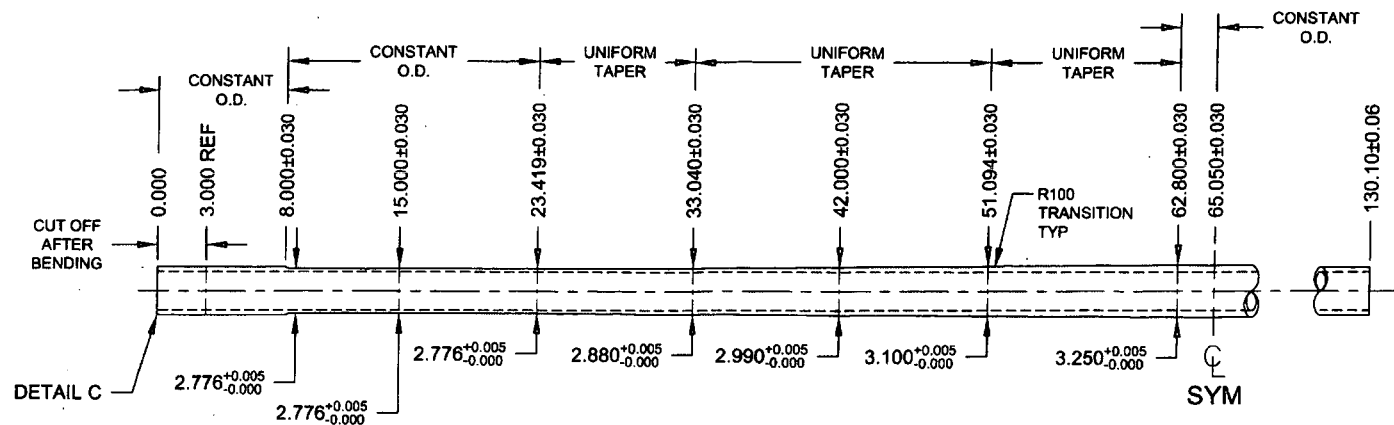

D412-664-443TRN
TURNING DETAIL

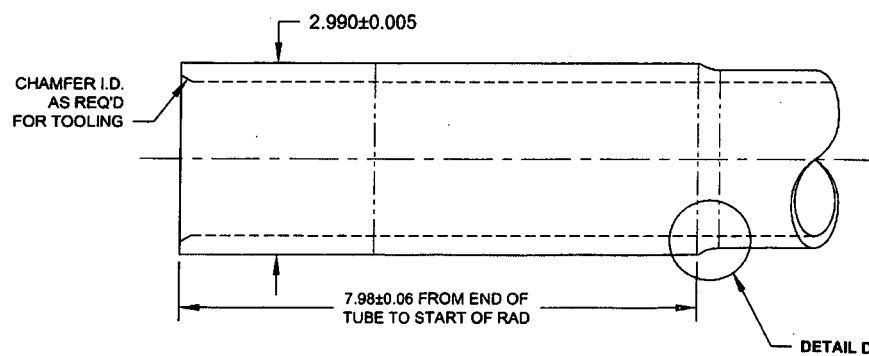

DETAIL C:
CUFF TRANSITION
SCALE 4X

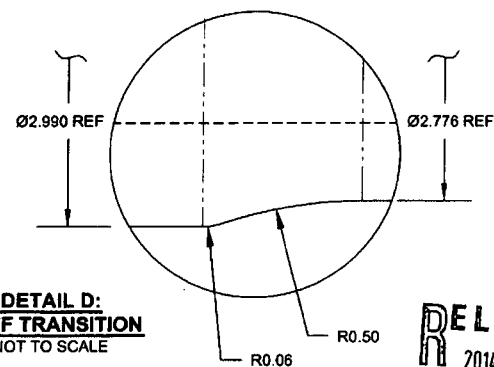

RELEASED
2014-05-26

DESIGN		DART AEROSPACE LTD	
DRAWN		HAWKESBURY, ONTARIO, CANADA	
CHECKED		DRAWING NO.	REV. A
MFG. APPR.		D412-664-443	SHEET 4 OF 4
APPROVED		TITLE	SCALE
DE APPR.		CROSSTUBE ASSEMBLY (412 HI AFT)	NTS
DATE	14.04.01	COPYRIGHT © 2013 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

Linda Lacelle

From: David Shepherd
Sent: April-02-15 2:01 PM
To: Linda Lacelle; Chris Provencal
Cc: Nigel Forbes
Subject: Re: AOG***NEW SO120870 HELISERVICIO SA DE CV - HOLLY

Completely agree with Chris on this. I think we need to do everything we can to make sure the tubes are well degrease before we start priming and painting the tubes.

David

From: Linda Lacelle
Sent: Thursday, April 2, 2015 10:54 AM
To: Chris Provencal
Cc: David Shepherd; Nigel Forbes
Subject: RE: AOG***NEW SO120870 HELISERVICIO SA DE CV - HOLLY

OK, thx!

From: Chris Provencal
Sent: April-02-15 1:50 PM
To: Linda Lacelle
Cc: David Shepherd; Nigel Forbes
Subject: RE: AOG***NEW SO120870 HELISERVICIO SA DE CV - HOLLY

We have no idea how the powder coat will perform. It would be much safer to paint them.

Chris

From: Linda Lacelle
Sent: Thursday, April 02, 2015 12:30 PM
To: Chris Provencal
Cc: David Shepherd; Nigel Forbes

Subject: FW: AOG***NEW SO120870 HELISERVICIO SA DE CV - HOLLY

Importance: High

We need to make 2 more for this order – D412-664-403 SS crosstubes, do we spray paint these also, or powdercoat???

Thx

Linda

From: Chantal Chartrand

Sent: April-02-15 12:04 PM

To: Sylvie Larocque; Brigitte Golden

Cc: Linda Lacelle; Mario Poulin; Melanie Fauteux; Sherri Van Eyk; Holly Menard

Subject: AOG***NEW SO120870 HELISERVICIO SA DE CV - HOLLY

PLEASE FIND ATTACHED NEW SO ***AOG***

****Use cost price on all doc and indicate customer's tax ID HEL120919QD0 in AWB****

Send Form 1/8130-3 in a different shipment to:

HELISERVICIO SA DE CV

PASEO DE LA REFORMA 2654

PISO 19, COL. LOMAS ALTAS

DEL. JOSE MIGUEL HIDALGO,

DF, CP 11950

MEXICO

ATTN: ROSARIO MENESES

AS SOON AS THE ORDER IS READY:

AOG freight service

Christine Provencal

Air Export Agent

SDV Logistiques (Canada) Inc.

3333 Douglas B. Floreani

St-Laurent, Québec, Canada, H4S 1Y6

Tel. 514-338-4444 ext (3343) – Direct: 514-338-4719 - Fax: 514-956-0079

c.provencal@sdv.ca

aogsdivyul@sdv.ca

D412-664-403 Stainless Steel Hardened Crosstube

setup

3.25" rollers

Bend lines are @ 32", 35" from centerline of tube

1.75" shims are used in the buggy for side bends

Middle Bend

Middle bend goes from 35" line with crosstube being on the large table of the machine.

Approach for middle bend is 2870 on both rollers. Run programs ~~middle 1-6~~ check.

Middle Auto, 6, Check

Side Bends

Run programs side 1-10 down the taper from 32" tangent line. Approach is 2900 on Y roller and 3385 on W roller. Programs 1-5 go back to the tangent line ready for next bend. Program 6-10 release at the end. Approaches on programs 6-10 are on the first line of programs... Programs 11-15 run down taper for 9" then come back up to finish tube slowly, be careful with these programs...

Enjoy

Notes:

13/12/12 ran 1 tube, program middle 6 was not enough, prog middle 7 overbent slightly. will create middle 6b to be a halfway point. after program 7 we ran the tube as per folio. one side finished nicely at program 10, the opposite side finished nicely after running program 1 2 times, then 13 to finish. this left the tube closer to max tolerance on the span, 53.730/53.800.

1
2
3
4
5
6
7
8
9
10
11
12
13
14
15
16
17
18
20
21
22
23

MAuto
6
6b
14

1
2
3
4
5
6
7
8
9
10
11
12
13
14
15
16
17
18
20
21
22
23



Dart Aerospace Ltd.
1270 Aberdeen Street
Hawkesbury, ON K6A 1K7
Tel: 613 632 9577
Fax: 613 632 1053

PURCHASE ORDER

Purchase Order ID **PO28069**

Purchase Order Date 4/10/2015

PO Print Date 4/10/2015

Page Number 3 of 4

Order From :
SKYSERVICE
6120 MIDFIELD ROAD
MISSISSAUGA, ONTARIO L5P 1B1
CANADA

VC-SKY001

Ship To : DART AEROSPACE LTD
1270 ABERDEEN
HAWKESBURY, ON K6A 1K7
CANADA

Contact Name
Vendor Phone 905-678-5636

Ship To Contact
Ship To Phone

Ship Via: Delivered
Ship Acct:

Buyer Chantal Lavoie
Customer POID
Customer Tax # 10127-2607
Terms Net 30
Currency CAD
FOB FCA - (Free Carrier)

Line Total: \$147.85

6	122227	D412-664-403 CROSSTUBE	4/10/2015	1.00	\$147.85	\$147.85
			Yes 4/10/2015			
LIQUID PENETRANT INSPECTION AS PER QSI 038 OR LPI AS PER ASTM 1417 LEVEL 2						

Line Total: \$147.85

7	130088	D412-664-403 CROSSTUBE	4/10/2015	1.00	\$147.85	\$147.85
			Yes 4/10/2015			
LIQUID PENETRANT INSPECTION AS PER QSI 038 OR LPI AS PER ASTM 1417 LEVEL 2						

Line Total: \$147.85

8	130096	D412-664-403 CROSSTUBE	4/10/2015	1.00	\$147.85	\$147.85
			Yes 4/10/2015			
LIQUID PENETRANT INSPECTION AS PER QSI 038 OR LPI AS PER ASTM 1417 LEVEL 2						

CX15/04/10

Note:

4/10/2015

**skyservice****Work Order Traveler**

Sky Service F.B.O. Inc.

DOT APP 53-89 / EASA 145.7142 / BDA AMO 385

WO #: MWO24194	Customer: Dart Aerospace Ltd.	Dept: NDT YUL	Reference: 28069
Descr:	PN:	S/N:	Qty: 1
Make:	Model:	Reg:	A/C S/N:
TSN:	CSN:	TSO:	
Task: UNSCHEDULED			Sequence: 1

Work Required:

CARRY OUT NDT ON 7 CROSSTUBES AS PER PO28069

4 STAINLESS STEEL 412 AFT CROSSTUBES, ITEM ID# D412-664-403 , WORK ORDERS ID# 122227, 122226, 130088, 130096

2 FWD CROSSTUBES , ITEM ID# D206-667-103RLC , WORK ORDERS ID# 128602, 128601

1 FWD CROSSTUBE , ITEM ID# D407-667-105 , WORK ORDER ID# 130374

Action Taken:						Date:	Initial/Stamp:
LPI C/O IAW ASTM E-1417M-13 NO CRACK FOUND ARDROX 970P25E BATCH# 2312131, M-20141						APR 10 2015	
Description	Location	P/N	Qty	Batch	S/N Off	S/N On	

I certified that the maintenance described above has been performed in accordance with the applicable standard of airworthiness.

Signature:	ACA/SCA Stamp 	Date: APR 10 2015
Name: RAFIK MELIKIAN		